

44

Date: Tuesday, 10/2/2007 1:23:46 PM  
 User: Kim Johnston

## Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: FLOAT SKID RH 206L1,L3,L4&407
Job Number	: 34961		
Estimate Number	: 10328		
P.O. Number	: N/A	Part Number	: D206642512
This Issue	: 10/2/2007 S.O. No. : N/A	Drawing Number	: N/A
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: N/A Type : LANDING GEAR	Drawing Revision	: K
Previous Run	: 34586	Material	: N/A
Written By	: <u>10/2/07</u>	Due Date	: 10/30/2007
Checked & Approved By	: <u>10/2/07</u>	Qty:	1 Um: Each
Comment	Est Rev:B 05.09.23 Revised per D206-642 Rev. J KJ/JLM Est Rev:C 07-02-23 As per IIN D206-642 Rev K JLM est rev D 07.06.06 added K642-512 EC		

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-512 CHG003

KS 07/10/05 (1)

2.0	34961A	FLOAT SKIDTUBE ASSEMBLY
-----	--------	-------------------------


 Comment: Sub-Component FLOAT SKIDTUBE ASSEMBLY  
 D206-642-541 B 34961A SD

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0	K642 512	saddle kit 642-511
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

saddle kit 642-512

batch: 36316

SQ 07-12-18 (1)

5.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
-----	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ Date: 21/12/19  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/2/2007 1:23:47 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKID RH 206L1,L3,L4&407

Job Number: 34961

Part Number: D206642512

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-512

Location: C

7/12/18 SQ (12)

AS of 12/18 (1)

7.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

(1)  
207/12/19

Job Completion



min 2007/12/18  
u

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

44

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: FLOAT SKIDTUBE ASSEMBLY
Job Number	: 34961A		
Estimate Number	: 10309		
P.O. Number	: N/A	Part Number	: D206642541
This Issue	: 10/2/2007 S.O. No. : N/A	Drawing Number	: D3274 REV D
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: N/A Type : LANDING GEAR	Drawing Revision	: D
Previous Run	: 34960A	Material	: N/A
Written By	: <u>[Signature]</u>	Due Date	: 10/30/2007 Qty: 1 Um: Each
Checked & Approved By	: <u>[Signature]</u>		
Comment	: Est Rev: B 05-09-23 Revised per D206-642 Rev. J KJ/JLM Est Rev: C 07-02-23 Added SS Wearplates & Gaskets JLM		

Job Number:



1.0 DC DOCUMENT CONTROL



Photocopy bluefile & type labels per PPP D206-642-541 CHG003

N/A ~~AA~~

20 D26001190 Extrusion Round 3" 206



Pick:

1 D2600-1-190 3" OD Tube

DP 7-10-15

3.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

- 1-Cut D2600-1 to 190.00" in length as per Dwg D3274 and Deburr ends
- 2-Drill #40 Aft cap pilot hole using DT8025
- 3-Cleco DT8025 in position and install pilot hole drill Jig DT8742A,B,C,D. Drill 3/16" pilot holes as per Dwg D3274
- 4-Remove inner indexing ridge on aft end of skidtube as per Dwg D3274
- 5-Open aft end cap holes to Ø0.208" as per Dwg D3274. Deburr aft end.

7-10-75

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/2/2007 1:24:29 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 34961A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

4.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid Etch and Alodine tube as per QSI 005 4.1

Job 7-10-16

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

EF 07/10/16

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

EF 07/10/16

7.0

D3282041

I-Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3282-041 Float Web

B 34794

AWM 07-10-23

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Ø0.313" crossbolt spacer holes using DT8743 as per Dwg D3274

2-Open Ø0.375" crossbolt spacer holes using DT8744 as per Dwg D3274

3-Deburr crossbolt spacer holes as per Dwg D3274 and blow out chips from inside the tube

4-Bond web in place as per Dwg D3274 & QSI 015.

A/R Sikaflex-291

Sikaflex expire date:

Start: 10-00

Finish: 07/10/24

(Adhere for 12 hours)

Time: 10:00 AM

Time: 7:00 AM

AWM/DR 07-10-23

AWM 07-10-16

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

EF 07/10/24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Tuesday, 10/2/2007 1:24:29 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 34961A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Bend tube using program D3274 as per Dwg D3274. Install drop pins in cross bolt spacer holes to maintain web position.

2-Cut Fwd end of tube to length as per Dwg D3274

\*\*\*\*\*Verify dimensions before and after cutting\*\*\*\*\*

3-Remove inner indexing ridge on Fwd end of skidtube as per Dwg D3274

4- DRILL PILOT HOLES FOR WEARPLATES USING D3274-1T2  
OPEN HOLES TO .297"

5-DRILL TOE PIN HOLE .640" DIA AS PER DWG USING DT8935 FWD END OF TUBE  
DEBURR INSIDE OF HOLE AS NECESSARY (DO NOT ENLARGE HOLES)  
REMOVE ANY FOREIGN OBJECTS INSIDE OF TUBES

6- Countersink crossbolt spacer holes as per Dwg D3274

EL/SK

7-10-24

7-10-25

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

12.0

D32851

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3285-1

Fwd Cap

B-33902 BE 07-10-30

13.0

D2649

Crossbolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick:

Qty Part Number

Description Batch

12 D2649

Crossbolt spacer

B-34612 BE 07-10-30

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/2/2007 1:24:29 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 34961A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

14.0

D32751

Crossbolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick:

Qty Part Number Description Batch

12 D3275-1 Crossbolt spacer

*BE 07-10-30*

15.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Weld Fwd Cap as per Dwg D3274 and QSI 004. Use aluminum rod.

A/R Aluminum Rod *M105138 BE 07-10-30*

2-Insert D2649 & D3275-1 crossbolt spacers. Weld as per QSI 004 and Dwg D3274. Remember to back drill each hole before welding the other side. Use aluminum rod

A/R Aluminum Rod *M105138 BE 07-10-30*

3-Grind welds flush to Fwd cap on top surface only. *BE 07-10-30*

4-Grind cross bolt welds flush as per Dwg D3274. Masking Tape access to inside of the skidtube *DP 7-10-30*

5-Counterbore 5/16" x 0.750" deep as per Dwg D3274. Use DT8743 visual aid Jig and deburr. *DP 7-10-30*

16.0

QC5

INSPECT WORK TO CURRENT STEP.



Comment: INSPECT WORK TO CURRENT STEP

17.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

18.0

POWDER COATING

POWDER COATING



*M105914*



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

*PD 07-10-31*  
*M-1 07/11/05*  
*PRESSURE WASH BR 07/11/05*

19.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*BR 07-11-05*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/2/2007 1:24:29 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 34961A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

D3415041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3415-041 Nut Plate B 33842

BR

21.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivet M 103525

BR

22.0

CR3212403

Cherry Rivet

\*



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CR3212-4-03 Rivet M 15918

BR

23.0

ALS71032130

Insert

\*



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Insert

Batch: M 105729

BR

24.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install Nut Plate as per Dwg D3274. Apply LPS-3 to Nut Plate and rivets.

A/RN/ALPS-3 M 105005

2-Install inserts as per Dwg D3274. Use a drop of Sikaflex inside insert holes a

A/R Sikaflex-291 M 105585

Sikaflex expire date: 08-07

BR 07-11-05

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Tuesday, 10/2/2007 1:24:29 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 34961A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP  
Inspect Nut Plate & Inserts

*5 Holes*

26.0

AN3C4A

BOLT



Comment: Qty.: 80.0000 Each(s)/Unit Total : 80.0000 Each(s)  
BOLT  
Batch: *M 105143*

*BR*

27.0

D353515

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
WEARSHOE  
Batch: *B34624*

*BR*

28.0

D353523

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
WEARSHOE  
Batch: *B35218*

*BR*

29.0

D353535

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
WEARSHOE  
Batch: *B34883*

*BR*

30.0

D353539

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
WEARSHOE  
Batch: *B35257*

*BR*

31.0

D353615

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
GASKET  
Batch: *B 33964*

*BR*

*BR 07-11-05*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Tuesday, 10/2/2007 1:24:29 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 34961A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

D353623

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B33965

BR

33.0

D353635

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B33689

BR

34.0

D353639

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B33966

BR

35.0

D35371

WEARPAD



Comment: Qty.: 9.0000 Each(s)/Unit Total : 9.0000 Each(s)

WEARPAD

Batch: B34282 ⑤ B34943 ④

BR

36.0

D35373

WEARPAD



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPAD

Batch: B33285

BR

37.0

AN960C10L

washer



Comment: Qty.: 80.0000 Each(s)/Unit Total : 80.0000 Each(s)

Pick:

Qty Part Number

Description Batch

80 AN960C10L

Washer M105143

BR

38.0

NAS1515H3L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 NAS1515H3L

Washer M105116

BR

BR 07-11-05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/2/2007 1:24:29 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 34961A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

39.0

D34131

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3413-1 Ring

B 33433

BR

40.0

AN4C5A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN4C5A Bolt

M 18918

BR

41.0

AN960C416

washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960C416 Washer

M 100993

BR

42.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646 Aft Cap

B 31335

BR

43.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

2-Install wearpads & gaskets as per Dwg D3274.

3-Install ring as per Dwg D3274

A/R Sikaflex-291

M 105585

Sikaflex expire date:

08-07

4-Inspect for foreign objects as per QSI 024

5-Spray inside of tube on both sides of web with LPS-3

A/R LPS-3

Batch: M 105005

6-Install Aft Cap and seal with Sikaflex. Clean excess adhesive.

BR 07-11-05  
BR 07-11-05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ Date: 01/12/19  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 10/2/2007 1:24:29 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 34961A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

A/R Sikaflex-291

Sikaflex expire date:

*M 105 585*  
*08-07*

*BR 07-11-05*

44.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*5 07/11/05*

45.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and stock

Location: \_\_\_\_\_

*7/12/18 500 (17)*

46.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

*(1)*  
*D207/12/19*

Job Completion



*pin 2007/12/18*  
*u*

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART**

DESIGN <b>CP</b>	DRAWN BY <b>PH</b>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <b>[Signature]</b>	APPROVED <b>[Signature]</b>	DRAWING NO. <b>D3274</b>	REV. D SHEET 1 OF 4
DATE <b>06.12.19</b>		TITLE <b>SKIDTUBE ASSEMBLY</b> SCALE NTS	
A	04.03.15	NEW ISSUE	
B	04.08.09	MOVE SADDLE HOLE: 42.14 WAS 42.76	
C	05.03.16	ADD -043; NEW INSERTS	
D	06.12.19	NEW INSERTS, SS WEARSHOE + GASKET	

**RELEASED**07.02.12 **[Signature]**

Qty -041	Qty -043	Part Number	Description
X		D3274-041	SKIDTUBE ASSEMBLY
	X	D3274-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
1	1	D2646	AFT CAP
12	12	D2649	CROSS BOLT SPACER
12	37	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
1	1	D3535-15	WEARSHOE
1	1	D3535-23	WEARSHOE
1	1	D3535-35	WEARSHOE
1	1	D3535-39	WEARSHOE
1	1	D3536-15	GASKET
1	1	D3536-23	GASKET
1	1	D3536-35	GASKET
1	1	D3536-39	GASKET
9	9	D3537-1	WEARPAD
1	1	D3537-3	WEARPAD
78	78	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
80	80	AN3C4A	BOLT
1	1	AN4C5A	BOLT
1	1	AN960C416	WASHER
80	80	AN960C10L	WASHER
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
2	2	NAS1515H3L	WASHER


**GENERAL NOTES:**

- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- ALL HOLES DRILLED ON CENTERLINES.
- BOND D3282-041 FLOAT WEB INTO D3274-1/-3 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/-291 ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
- WELDING TO BE DONE PER DART QSI 004.
- FINISH: - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1  
- POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
- DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT3274-1T2 BEFORE FINISH. INSTALL ALS7-1032-130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX -241/-291.
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.


UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
34961A

**Copyright © 2004 by DART AEROSPACE USA, INC.**


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

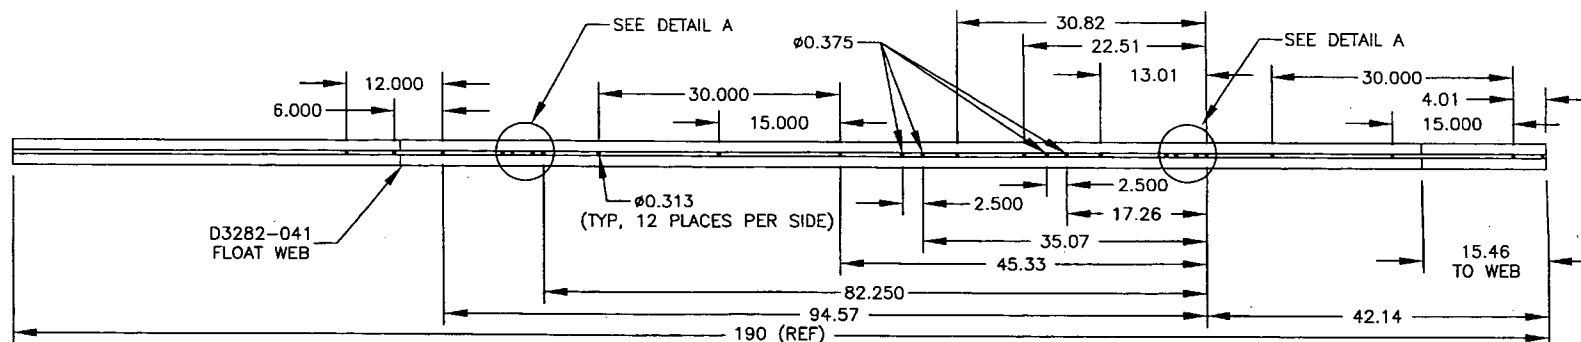

**D3274-041 DRILLING/ASSEMBLY DETAIL**

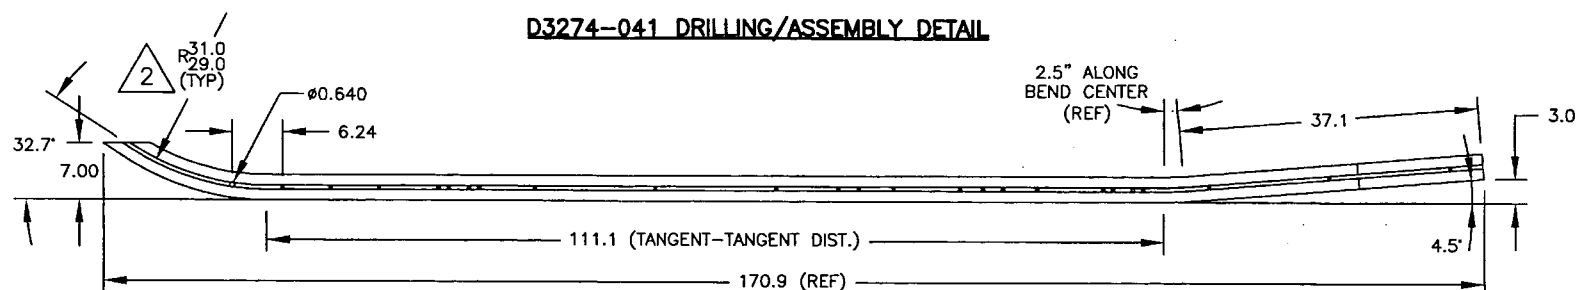

**D3274-041 BEND/DRILLING DETAIL**

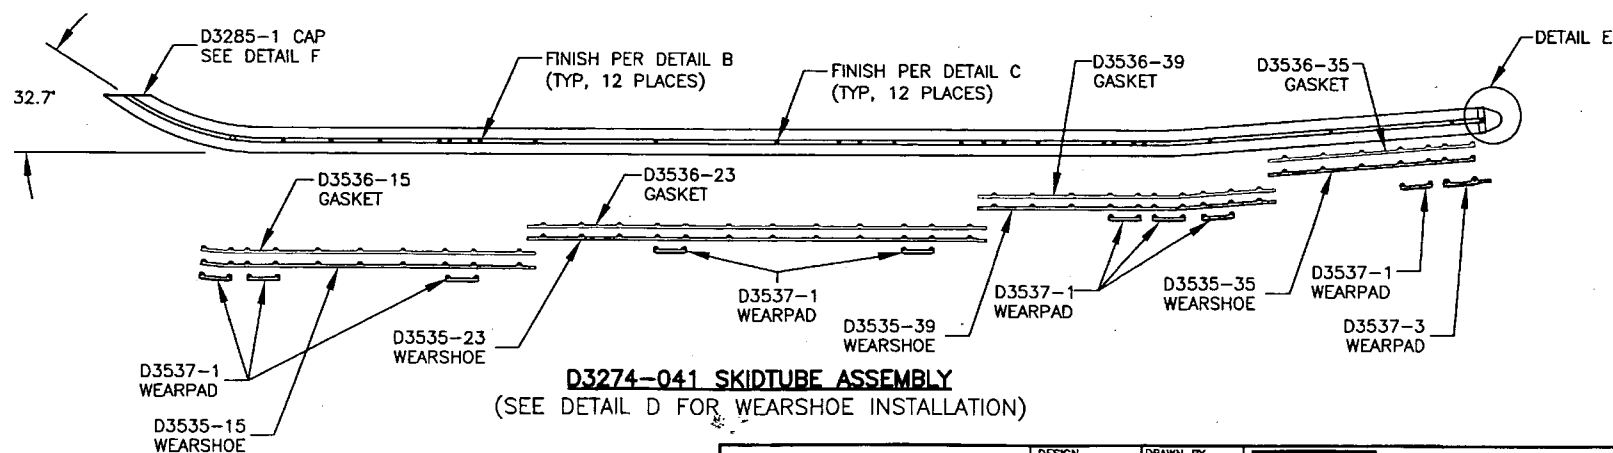

**D3274-041 SKIDTUBE ASSEMBLY**  
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

NO. 34961 A  
WORK ORDER  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
UNCONTROLLED COPY  
ENGINEERING  
RETURN TO  
SHOP COPY

RELEASED


07.02.12

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, WA	REV. 0
CHECKED	#	APPROVED	#	DRAWING NO. D3274	SHEET 2 OF 4
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	SCALE	1:15




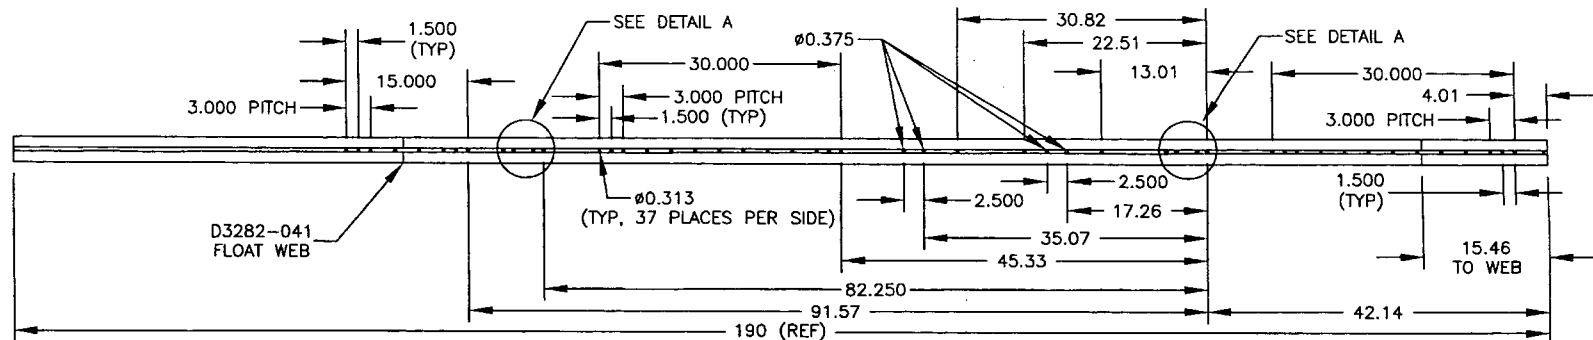

**D3274-043 DRILLING/ASSEMBLY DETAIL**

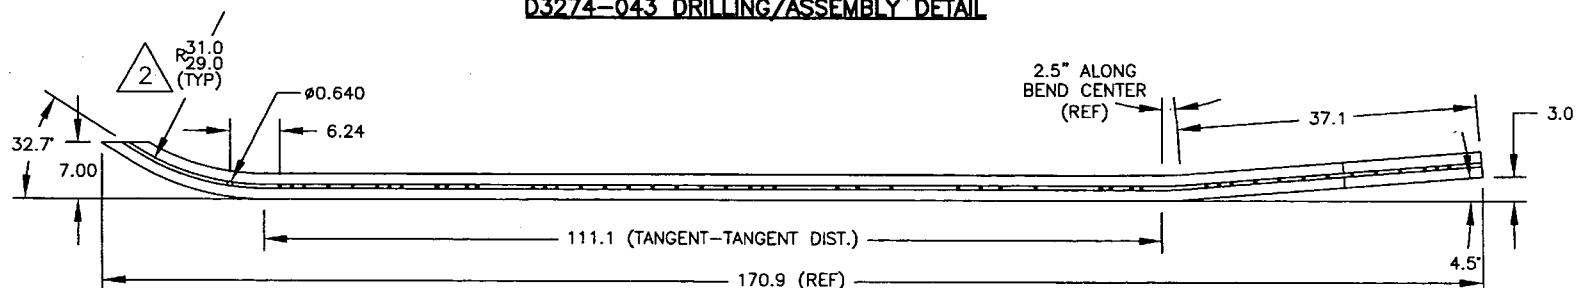

**D3274-043 BEND/DRILLING DETAIL**

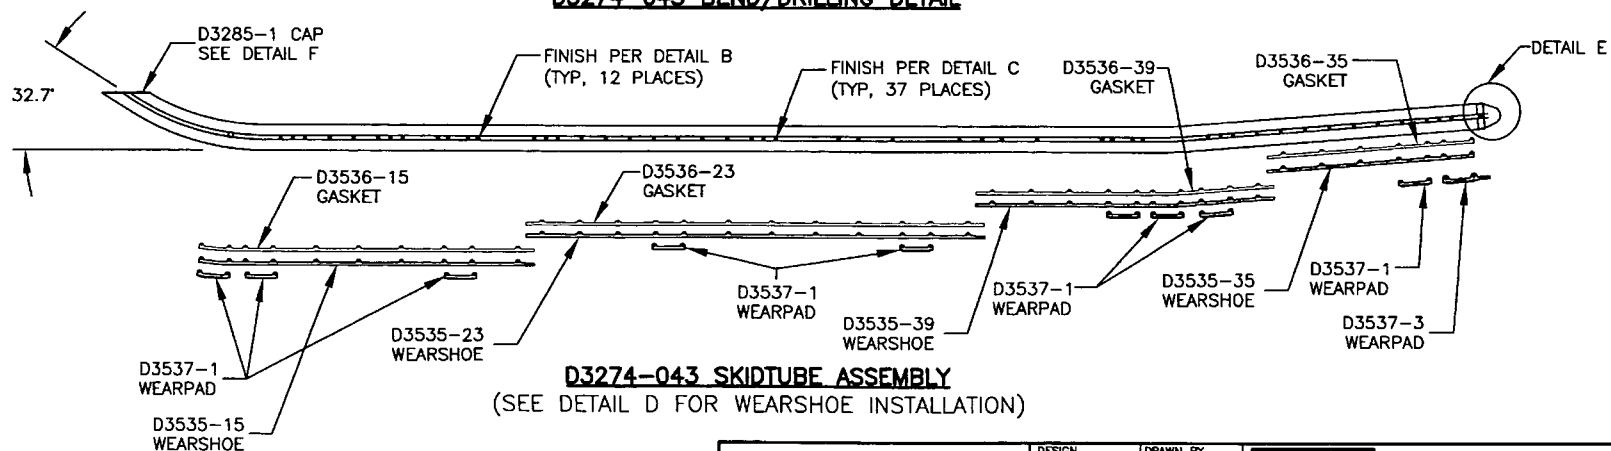

**D3274-043 SKIDTUBE ASSEMBLY**  
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 34961A

RELEASED


07.02.12

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, MA
CHECKED	#	APPROVED	#	DRAWING NO. D3274
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	REV. D SHEET 3 OF 4 SCALE 1:15

# **DETAIL A: DRILL DETAIL**

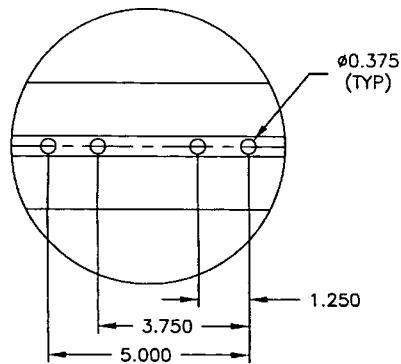


## **DETAIL B** FOR 0.375 HOLES ONLY

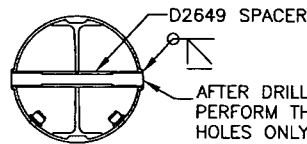


- AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR 0.375  
HOLES ONLY:
1. CHAMFER HOLE 0.030x45°
  2. INSERT D2649 SPACER
  3. WELD INTO PLACE AND GRIND FLUSH
  4. C'BORE TO 0.313x0.75 DEEP

## **DETAIL C** FOR 0.313 HOLES ONLY

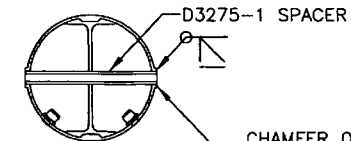

CHAMFER 0.030x45°  
(TYP)

## **DETAIL D**

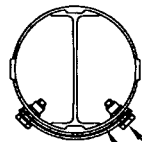

- ALS7-1032-130 INSERT (1)  
AN3C4A BOLT (1)  
AN960C10L WASHER (1)  
(78 PLACES)

GASKET/WEARSHOE/WEARPAD (REF)

## **DETAIL E**

D2646 CAP

- AN3C4A BOLT (1)  
AN960C10L WASHER (1)  
NAS1515H3L WASHER (1)  
(2 PLACES)  
INSTALL WITH SIKAFLEX-241/-291


SEAL WITH  
SIKAFLEX-241/291  
ADHESIVE

0.208 (2 PLACES)  
DRILL PRIOR TO INSTALLING  
D2646 CAP

BORE OUT END OF SKIDTUBE  
TO 0.75 DEPTH AND 0.070 WALL

0.400

## **DETAIL F: END FINISHING DETAIL**

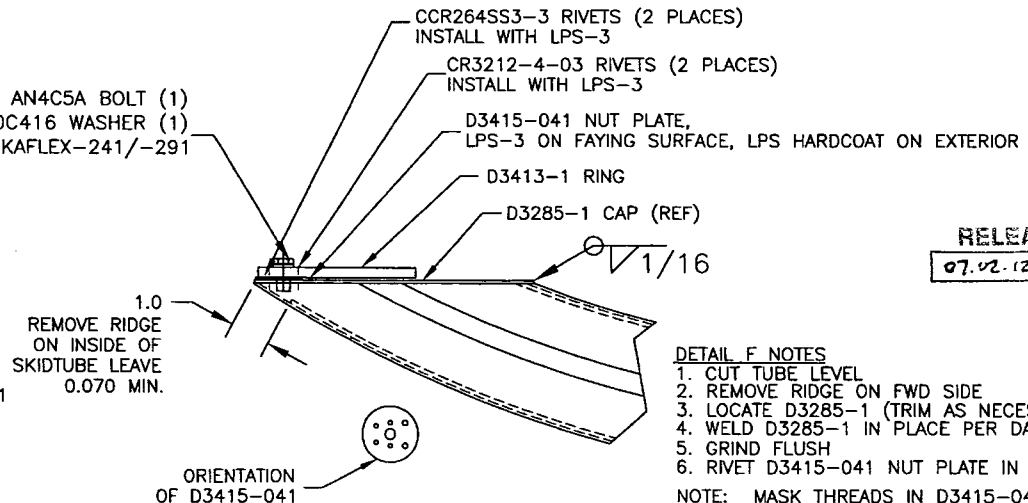

### **DETAIL F NOTES**

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D3285-1 (TRIM AS NECESSARY)
4. WELD D3285-1 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D3415-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D3415-041  
PRIOR TO FINISH

RELEASED

07.02.12

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE USA, INC.

DESIGN CP	DRAWN BY PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. D
CHECKED H	APPROVED H	DRAWING NO. D3274	SHEET 4 OF 4
DATE 06.12.19	TITLE SKIDTUBE ASSEMBLY	SCALE 1:3	

NO. 34961 A  
WORK ORDER  
WITHOUT NOTICE  
SUBJECT TO AMENDMENT  
UNCONTROLLED COPY  
ENGINEERING  
RETURN TO  
SHOP COPY

NO. 131

# AWS D17.1.2001 QUALIFICATION TEST RECORD

Name Barclay Elliot  
Joint Welding Procedure TIG  
Part number and Job number DD206 642 541 / B34772

## TEST WELDS REQUIRED

BASE METAL Aluminum WELDING PROCESS TIG  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position		Vertical Down <input type="checkbox"/> Up <input type="checkbox"/>	
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input checked="" type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skid tube

## TEST RESULTS

Visual Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐  
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07-10-19 Qualifier Pat Dault